

Product Information TFP-42, -52, -62, -162, -182

FOOD

Temperature Sensor with M12 hygienic



Application / Specified Usage

- Temperature Measurement in pipes DN15...DN80
- Temperature measurement in thin-walled pipes and vessels

Application Examples

- Process monitoring
- Monitoring of CIP- / SIP-process
- Temperature measurement in UHT-plants

Hygienic Design / Process Connection

- Flow optimized, hygienic and easy sterilizable installation by using Negele weld-in sleeve, e.g. EMK-032 or build-in system, e.g. EHG-... / M12
- Additional process connections: adapters for TriClamp, dairy flange (DIN 11851), Varivent, DRD, APV et al
- Sealing system free of elastomers, the connection will be without gaps and crevices
- Product contacting materials compliant to FDA
- Sensor completely made of stainless steel

Features / Advantages

- Integrated transmitter optional
- Different electrical connections available

Options / Accessories

- 2 x Pt100 (not retrofittable)
- 2 x Pt100 with two transmitters (not retrofittable)
- Programmable transmitters MPU-4 as well as MPU-M with output 4...20 mA, 2-wire
- Integrated transmitters for Profibus PA and HART-protocol
- Integrated transmitter MPU-LCD with display in connecting head
- Programming adapter MPU-P 9701
- Pt100 chip with other classes of accuracy (1/3B, 1/10B)
- Sensor tips with diameter 3 mm and 4 mm
- Spacer for high temperature up to 250 °C permanent temperature up to 600 °C (on request)
- Pre-assembled connecting cable for M12-plug
- Fixed cable in other lengths and other material available
- Calibration certificate (optional with order)

Authorizations



Temperature Sensor TFP-42



Temperature Sensor TFP-162 with transmitter MPU-M



Temperature sensor		
Process connection	thread	M12 CLEANadapt; combined with Negele weld-in sleeves, build-in-systems, adapter sleeves
Tightening torque		10 Nm
Insertion length	standard	20...500 mm
Materialis	connecting head thermowell	stainless steel 1.4305 stainless steel 1.4404
Operating pressure		50 bar maximum
Temperature ranges	ambient sensor tip	-50...+80 °C -50...+250 °C
Sensing resistor	acc. to DIN EN 60751	Pt100
Electrical connection	cable gland cabel connection fixed cable 2,5 m fixed cable 2,5 m (>90 °C)	M16 x 1,5 M12-plug 1.4305, 4-pins LIYY 4 x 0,25 mm ² PTFE 4 x 0,14 mm ²
Protection class		IP 69 K (with electrical connection M12-plug)


Transmitter MPU-4, MPU-10, MPU-H, MPU-M		
Temperature ranges	ambient storage	-40...+85 °C -55...+90 °C
Measuring ranges	MPU-4, MPU-H, MPU-M MPU-10	standard: -10...40 °C, 0...50 / 100 / 150 / 200 °C special ranges free programable standard: -200...850 °C configuration occurs with Profibus
Accuracy	input	< ±0.25 °C
Temperature drift	zero, span	< 0.01 % / K
Supply	MPU-M, MPU-4 MPU-10 accuracy	8...35 V DC 9...32 V DC 0.01 % / V (reference: 12 V DC)
Output	signal accuracy burden	analog 4...20 mA (not for MPU-10) < ±0.1 % of measurement range < 600 Ω (at U _B = 24 V)
Humidity	without condensation	0...98 %

Accuracy classes of temperature sensors | Tolerances for Pt100 acc. to DIN EN 60751


Pt100	A	1/3 B	1/10 B
0 °C / 100 Ω	±0.15 K / ±0.06 Ω	±0.10 K / ±0.04 Ω	±0.03 K / ±0.01 Ω
100 °C / 138.5 Ω	±0.35 K / ±0.13 Ω	±0.27 K / ±0.10 Ω	±0.08 K / ±0.03 Ω

Electrical connection without transmitter

With 1 x M12 plug

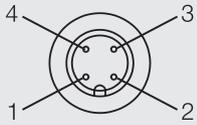


Configuration 1st M12 plug

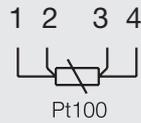

Electrical connection with transmitter


With M12 plug

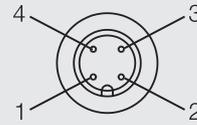


Configuration M12 plug

- 1: + supply
- 2: - supply 4...20 mA
- 3: not connected
- 4: not connected


With 2 x M12 plug

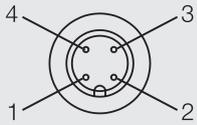


Configuration 2nd M12 plug

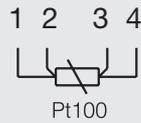


With cable gland

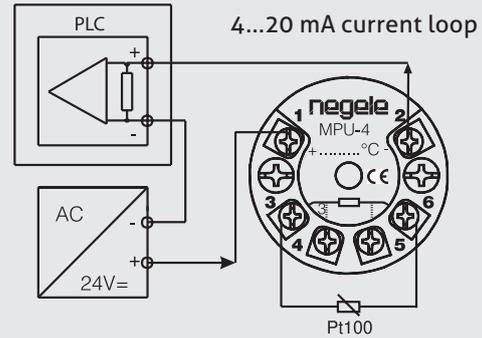

With cable gland

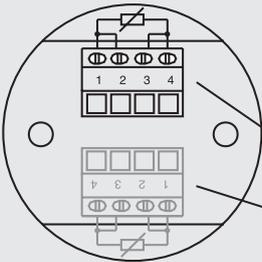


Configuration strip terminal

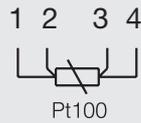

- clamps for 1st Pt100
- clamps for 2nd Pt100 (at version 2 x Pt100)

Electrical connection with two transmitter (TFP-62)

With 1 x M12-plug (sensor 1 + sensor 2)

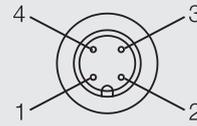

Configuration M12-plug


- 1: + supply (sensor 1)
- 2: - supply 4...20 mA (sensor 1)
- 3: - supply 4...20 mA (sensor 2)
- 4: + supply (sensor 2)

With fixed cable




Fixed cable connection with 1 x Pt100

wh ye bn gn standard
rd rd wh wh PTFE

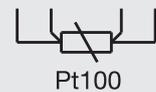


Fixed cable connection with 2 x Pt100 (LIYY)

wh ye bn gn 1st Pt100
rd bu pk gy 2nd Pt100




Fixed cable connection with 2 x Pt100 (PTFE)

rd rd wh 1st Pt100
vt vt ye 2nd Pt100




With 2 x M12-plug (sensor 1)

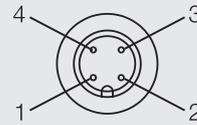

Configuration M12-plug

- 1: + supply (sensor 1)
- 2: - supply 4...20 mA (sensor 1)
- 3: not connected
- 4: not connected


With 2 x M12-plug (sensor 2)

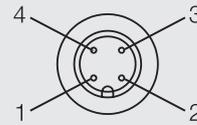


Configuration M12-plug

- 1: + supply (sensor 2)
- 2: - supply 4...20 mA (sensor 2)
- 3: not connected
- 4: not connected


TFP-42 | TFP-42.2

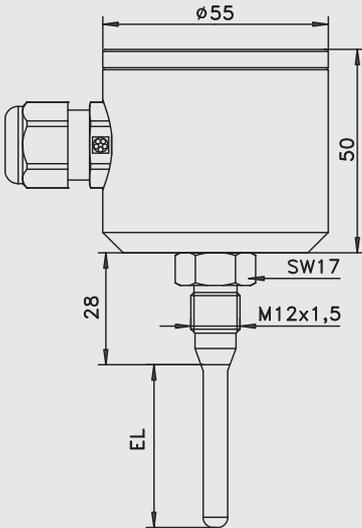

TFP-62

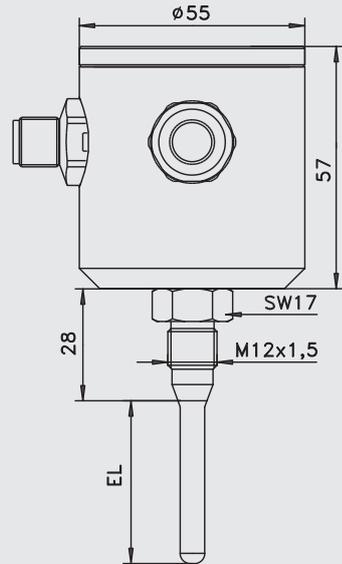

TFP-52 | TFP-52.2

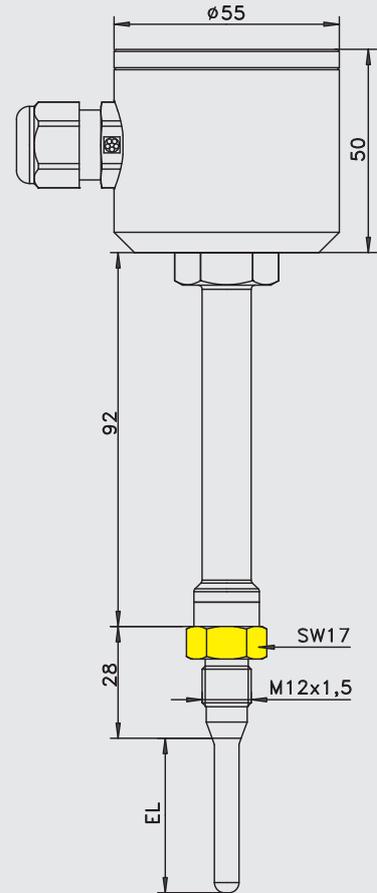


Important advice for TFP-52 und -52.2




Tighten the sensor only at the lower, marked in yellow spanner flat (BE = 17 mm)!


TFP-162

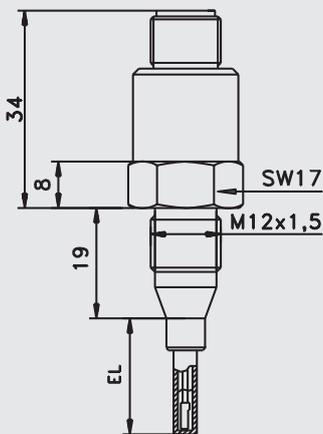

TFP-162 / ... / MPU-M

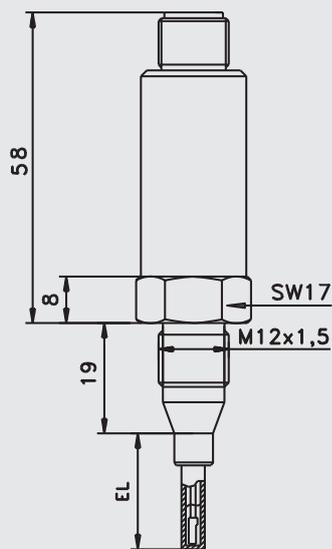

TFP-182 | TFP-182.2

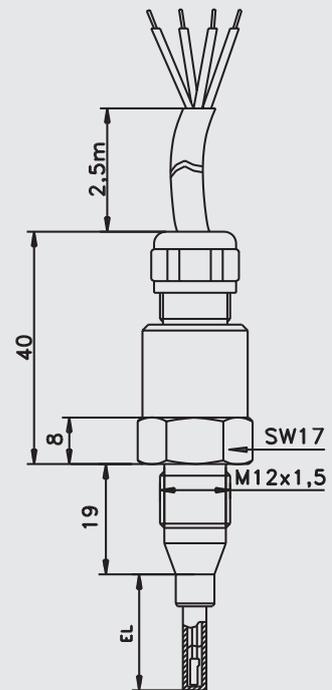


Sensor tip diameter and response time


All temperature sensors are available with smaller sensor tips, to ensure a shorter response time. The below-mentioned times were measured by emerging a temperature sensor from room temperature into boiling water.

Sensor tipe Ø 6 mm


50 %-time: $t_{50} \leq 3,0$ s
90 %-time: $t_{90} \leq 8,0$ s

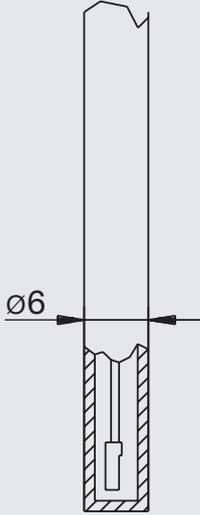**Sensor tip Ø 4 mm**

50 %-time: $t_{50} \leq 2,4$ s
90 %-time: $t_{90} \leq 6,5$ s

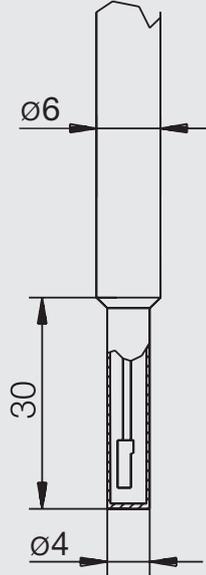**Sensor tip Ø 3 mm**

50 %-time: $t_{50} \leq 0,5$ s
90 %-time: $t_{90} \leq 1,5$ s

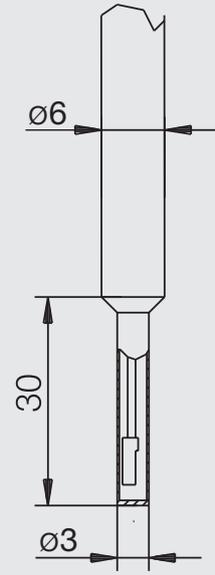

Mechanical Connection / Installation

- Use only Negele CLEANadapt system for safe operation of measuring point!

Conventional Usage

- Not suitable for applications in explosive areas.
- Not suitable for applications in security-relevant equipments (SIL).

Transport / Storage

- No outdoor storage
- Dry and dust free
- Not exposed to corrosive media
- Protected against solar radiation
- Avoiding mechanical shock and vibration
- Storage temperature -55...+90 °C
- Relative humidity maximum 98 %

Reshipment

- Sensors shall be clean and free of media or heat-conductive paste and must not be contaminated with dangerous media!
- Use suitable transport packaging only to avoid damage of the equipment!

Cleaning / Maintenance

- In case of using pressure washers, don't point nozzle directly to electrical connections!

Standards and Guidelines

- You have to comply with applicable regulations and directives.

Disposal

- This instrument is not subject to the WEEE directive 2002/96/EC and the respective national laws.
- Pass the instrument directly on to a specialised recycling company and do not use the municipal collecting points.

Advice to EMC

- The device agrees to following standards: EMC directive 2004/108/EC.
- You have to guarantee the EMC directives for the entire equipment.

Temperature Transmitter MPU-LCD with Display

Application / Specified Usage

- 4...20mA transmitter with LCD for Pt100 temperature sensor
- For installation in temperature sensor
- Sensor monitoring

Features

- 4-digit display with green backlight
- Temperature measurement in °C and °F
- Easy range select by one button
- Lower costs for wiring because of 2-wire technology

Note

See product information „MPU-LCD“ for details.

**Option MPU-LCD
(display in the connection head)**

Order code for version with 1 x Pt100

TFP-42	(connecting head Ø 55 mm)
TFP-52	(connecting head Ø 55 with spacer)
TFP-162	(connecting head Ø 18 mm, electrical connection via M12-plug)
TFP-182	(connecting head Ø 18 mm, electrical connection via 2,5 m PVC-cable; other lengths: see accessories; no transmitter possible!)
Sensor length EL in mm	
020...500	(in steps of 5 mm)
xxx	(special length)
Diameter thermowell in mm (only selectable at sensor length > 30 mm)	
4	(only with sensor tip 4 mm)
6	
Diameter sensor tip in mm	
3	(only with thermowell 6 mm)
4	(only with thermowell 6 mm, standard when sensor length ≤ 30 mm)
6	(only with thermowell 6 mm)
Accuracy class Pt100	
A	
1/3B	
1/10B	
Electrical connection (not selectable at TFP-162 and -182)	
PG	(cable gland M16x1,5)
M12	(M12 plug, standard with MPU-LCD)
Transmitter	
X	(without)
for TFP-42 and -52	
MPU-4	(programmable)
MPU-10	(Profibus PA)
MPU-H	(HART-protocol)
MPU-LCD	(with display)
only for TFP-162 (not for TFP-182)	
MPU-M	(programmable)
Measuring range MPU (only for types with transmitter; not for MPU-LCD)	
-10...40	(range -10...40 °C)
0...50	(range 0...50 °C)
0...100	(range 0...100 °C)
0...150	(range 0...150 °C)
0...200	(range 0...200 °C)
xx...yy	(special range)
TFP-42 /	050 /
6 /	4 /
A /	PG /
MPU-4 /	0...100

Accessories

PVC-cable with M12-connection made of 1.4305, IP 69 K, unshielded

M12-PVC / 4-5 m	PVC-cable 4-pin, length 5 m
M12-PVC / 4-10 m	PVC-cable 4-pin, length 10 m
M12-PVC / 4-25 m	PVC-cable 4-pin, length 25 m

PVC-cable with M12-connection, brass nickel-plated, IP 67, shielded

M12-PVC / 4G-5 m	PVC-cable 4-pin, length 5 m
M12-PVC / 4G-10 m	PVC-cable 4-pin, length 10 m
M12-PVC / 4G-25 m	PVC-cable 4-pin, length 25 m

PVC-cable with M12-connection



Order code for version with 2 x Pt100

TFP-42.2	(connecting head Ø 55 mm, 2 x Pt100, no transmitter possible!)
TFP-52.2	(connecting head Ø 55 mm, 2 x Pt100, with spacer, no transmitter possible!)
TFP-62	(higher connecting head Ø 55 mm, 2 x Pt100, prepared for 2 x transmitter)
TFP-62-H	(like TFP-62, but with spacer)
TFP-182.2	(connecting head Ø 18 mm, electrical connection 2,5 m PTFE-cable; other lengths: see at accessories)

Sensor Length in mm

020...500 (in steps of 5 mm)
xxx (special length)

Diameter thermowell in mm (only selectable at sensor length > 30 mm)

4 (only with sensor tip 4 mm)
6

Diameter sensor tip in mm

3 (only with thermowell 6 mm)
4 (only with thermowell 6 mm, standard when sensor length ≤ 30 mm)
6 (only with thermowell 6)

Accuracy class Pt100

A
1/3B
1/10B

Electrical connection (only for TFP-42.2 and TFP-52.2)

PG (cable gland M16x1,5)
2 x PG (2 x cable gland M16x1,5)
2 x M12 (2 x M12-plug)

Electrical connection (only for TFP-62 and TFP-62-H)

M12 (M12-plug)
2 x M12 (2 x M12-plug)

Continue if TFP-62 or TFP-62-H is selected!
 No further options for TFP-42.2, -52.2, -182.2!

1. Transmitter

MPU-4 (programmable)

Measuring Range 1. MPU

-10...40 (measuring range -10...40 °C)
0...50 (measuring range 0...+50 °C)
0...100 (measuring range 0...+100 °C)
0...150 (measuring range 0...+150 °C)
0...200 (measuring range 0...+200 °C)
xx...yy (special range)

2. Transmitter

MPU-4 (programmable)

Measuring Range 2. MPU

-10...40 (-10...40 °C)
0...50 (0...+50 °C)
0...100 (0...+100 °C)
0...150 (0...+150 °C)
0...200 (0...+200 °C)
xx...yy (special)

TFP-62 / 100 / 6 / X / A / M12 / MPU-4 / 0...50 / MPU-4 / 0...50